Galmet Hammered Metal Finish

ITW POLYMERS & FLUIDS

Chemwatch: 53767 Version No: 2.1.1.1

Safety Data Sheet according to WHS and ADG requirements

Chemwatch Hazard Alert Code: 2

Issue Date: 01/01/2013
Print Date: 12/07/2016
Initial Date: Not Available
S.GHS.AUS.EN

SECTION 1 IDENTIFICATION OF THE SUBSTANCE / MIXTURE AND OF THE COMPANY / UNDERTAKING

Product Identifier

Product name	Galmet Hammered Metal Finish	
Proper shipping name	PAINT (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound)	
Other means of identification	Not Available	

Relevant identified uses of the substance or mixture and uses advised against

Relevant	identified
	uses

Decorative coating for steel and other surfaces.

Details of the supplier of the safety data sheet

Registered company name	ITW POLYMERS & FLUIDS	
Address	100 Hassall Street, Wetherill Park NSW 2164 Australia	
Telephone	+61 2 9757 8800	
Fax	+61 2 9757 3855	
Website	www.itwpf.com.au	
Email	Not Available	

Emergency telephone number

399 - 9		
Association / Organisation	Not Available	
Emergency telephone numbers	1800 039 008	
Other emergency telephone numbers	+61 3 9573 3112	

CHEMWATCH EMERGENCY RESPONSE

Primary Number	Alternative Number 1	Alternative Number 2
1800 039 008	+612 9186 1132	Not Available

Once connected and if the message is not in your prefered language then please dial 01

SECTION 2 HAZARDS IDENTIFICATION

Classification of the substance or mixture

HAZARDOUS CHEMICAL. DANGEROUS GOODS. According to the WHS Regulations and the ADG Code.

Poisons Schedule	S5	
Classification [1]	Flammable Liquid Category 3, Skin Corrosion/Irritation Category 2, Specific target organ toxicity - single exposure Category 3 (narcotic effects), Aspiration Hazard Category 1	
Legend:	1. Classified by Chemwatch; 2. Classification drawn from HSIS; 3. Classification drawn from EC Directive 1272/2008 - Annex VI	

Issue Date: 01/01/2013 Print Date: 12/07/2016

Label elements

GHS label elements







SIGNAL WORD

DANGER

Hazard statement(s)

H226	Flammable liquid and vapour.	
H315	Causes skin irritation.	
H336	May cause drowsiness or dizziness.	
H304	May be fatal if swallowed and enters airways.	
AUH066	Repeated exposure may cause skin dryness and cracking	

Precautionary statement(s) Prevention

P210	Keep away from heat/sparks/open flames/hot surfaces No smoking.	
P271	Use only outdoors or in a well-ventilated area.	
P240	Ground/bond container and receiving equipment.	
P241	P241 Use explosion-proof electrical/ventilating/lighting/intrinsically safe equipment.	

Precautionary statement(s) Response

P301+P310	IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician.	
P331	Do NOT induce vomiting.	
P362	Take off contaminated clothing and wash before reuse.	
P370+P378	In case of fire: Use alcohol resistant foam or normal protein foam for extinction.	

Precautionary statement(s) Storage

P403+P235	Store in a well-ventilated place. Keep cool.	
P405	Store locked up.	
P403+P233	P403+P233 Store in a well-ventilated place. Keep container tightly closed.	

Precautionary statement(s) Disposal

P501	Dispose of contents/container in accordance with local regulations.
FJUI	Dispose of contents/container in accordance with local regulations.

SECTION 3 COMPOSITION / INFORMATION ON INGREDIENTS

Substances

See section below for composition of Mixtures

Mixtures

CAS No	%[weight]	Name
8052-41-3.	10-30	white spirit
1330-20-7	1-10	xylene
	balance	ingredients nonhazardous

SECTION 4 FIRST AID MEASURES

Description of first aid measures

▶ Wash out immediately with fresh running water.

If this product comes in contact with the eyes:

Eye Contact

- ▶ Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- ▶ Seek medical attention without delay; if pain persists or recurs seek medical attention.
- ▶ Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

Chemwatch: **53767** Page **3** of **9**Version No: **2.1.1.1**

Galmet Hammered Metal Finish

Issue Date: **01/01/2013**Print Date: **12/07/2016**

Skin Contact	If skin contact occurs: Immediately remove all contaminated clothing, including footwear. Flush skin and hair with running water (and soap if available). Seek medical attention in event of irritation.
Inhalation	 If fumes or combustion products are inhaled remove from contaminated area. Lay patient down. Keep warm and rested. Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures. Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary. Transport to hospital, or doctor.
Ingestion	 For advice, contact a Poisons Information Centre or a doctor at once. Urgent hospital treatment is likely to be needed. If swallowed do NOT induce vomiting. If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration. Observe the patient carefully. Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious. Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink. Transport to hospital or doctor without delay.

Indication of any immediate medical attention and special treatment needed

For acute or short term repeated exposures to petroleum distillates or related hydrocarbons:

- Primary threat to life, from pure petroleum distillate ingestion and/or inhalation, is respiratory failure.
- Patients should be quickly evaluated for signs of respiratory distress (e.g. cyanosis, tachypnoea, intercostal retraction, obtundation) and given oxygen. Patients with inadequate tidal volumes or poor arterial blood gases (pO2 50 mm Hg) should be intubated.
- Arrhythmias complicate some hydrocarbon ingestion and/or inhalation and electrocardiographic evidence of myocardial injury has been reported; intravenous lines and cardiac monitors should be established in obviously symptomatic patients. The lungs excrete inhaled solvents, so that hyperventilation improves clearance.
- A chest x-ray should be taken immediately after stabilisation of breathing and circulation to document aspiration and detect the presence of pneumothorax.
- Epinephrine (adrenalin) is not recommended for treatment of bronchospasm because of potential myocardial sensitisation to catecholamines. Inhaled cardioselective bronchodilators (e.g. Alupent, Salbutamol) are the preferred agents, with aminophylline a second choice.
- Lavage is indicated in patients who require decontamination; ensure use of cuffed endotracheal tube in adult patients. [Ellenhorn and Barceloux: Medical Toxicology]

SECTION 5 FIREFIGHTING MEASURES

Extinguishing media

- ▶ Foam.
- ▶ Dry chemical powder.
- ► BCF (where regulations permit).
- Carbon dioxide.

Special hazards arising from the substrate or mixture

Fire	Incompatibil	lity

► Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result

Advice for firefighters

Fire Fighting

- Alert Fire Brigade and tell them location and nature of hazard.
- ► May be violently or explosively reactive.
- ▶ Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.

Fire/Explosion Hazard

- Liquid and vapour are flammable.
- ► Moderate fire hazard when exposed to heat or flame.
- Vapour forms an explosive mixture with air.
- ▶ Moderate explosion hazard when exposed to heat or flame.

Other combustion products include; carbon dioxide (CO2), aldehydes, other pyrolysis products typical of burning organic material

SECTION 6 ACCIDENTAL RELEASE MEASURES

Personal precautions, protective equipment and emergency procedures

Minor Spills

- ▶ Remove all ignition sources.
- ► Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.

Issue Date: **01/01/2013** Print Date: **12/07/2016**

Galmet Hammered Metal Finish

	► Control personal contact with the substance, by using protective equipment.
Major Spills	 Clear area of personnel and move upwind. Alert Fire Brigade and tell them location and nature of hazard. May be violently or explosively reactive. Wear breathing apparatus plus protective gloves.

Personal Protective Equipment advice is contained in Section 8 of the SDS.

SECTION 7 HANDLING AND STORAGE

Precautions for safe handling

Safe handling	 Containers, even those that have been emptied, may contain explosive vapours. Do NOT cut, drill, grind, weld or perform similar operations on or near containers. DO NOT allow clothing wet with material to stay in contact with skin Avoid all personal contact, including inhalation. Wear protective clothing when risk of overexposure occurs. Use in a well-ventilated area. Prevent concentration in hollows and sumps.
Other information	 Store in original containers in approved flammable liquid storage area. Store away from incompatible materials in a cool, dry, well-ventilated area. DO NOT store in pits, depressions, basements or areas where vapours may be trapped. No smoking, naked lights, heat or ignition sources.

Conditions for safe storage, including any incompatibilities

Suitable container	 Packing as supplied by manufacturer. Plastic containers may only be used if approved for flammable liquid. Check that containers are clearly labelled and free from leaks.
Storage incompatibility	► Avoid reaction with oxidising agents

SECTION 8 EXPOSURE CONTROLS / PERSONAL PROTECTION

Control parameters

OCCUPATIONAL EXPOSURE LIMITS (OEL)

INGREDIENT DATA

Source	Ingredient	Material name	TWA	STEL	Peak	Notes
Australia Exposure Standards	white spirit	White spirits	790 mg/m3	Not Available	Not Available	Not Available
Australia Exposure Standards	xylene	Xylene (o-, m-, p- isomers)	350 mg/m3 / 80 ppm	655 mg/m3 / 150 ppm	Not Available	Not Available

EMERGENCY LIMITS

Ingredient	Material name	TEEL-1	TEEL-2	TEEL-3
white spirit	Stoddard solvent; (Mineral spirits, 85% nonane and 15% trimethyl benzene)	100 ppm	350 ppm	29500 ppm
xylene	Xylenes	Not Available	Not Available	Not Available

Ingredient	Original IDLH	Revised IDLH
white spirit	29,500 mg/m3	20,000 mg/m3
xylene	1,000 ppm	900 ppm

Exposure controls

Appropriate engineering controls

Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly effective in protecting workers and will typically be independent of worker interactions to provide this high level of protection.

The basic types of engineering controls are:


Process controls which involve changing the way a job activity or process is done to reduce the risk.

Enclosure and/or isolation of emission source which keeps a selected hazard "physically" away from the worker and ventilation that strategically "adds" and "removes" air in the work environment.

Version No: **2.1.1.1**

Galmet Hammered Metal Finish

Issue Date: **01/01/2013**Print Date: **12/07/2016**

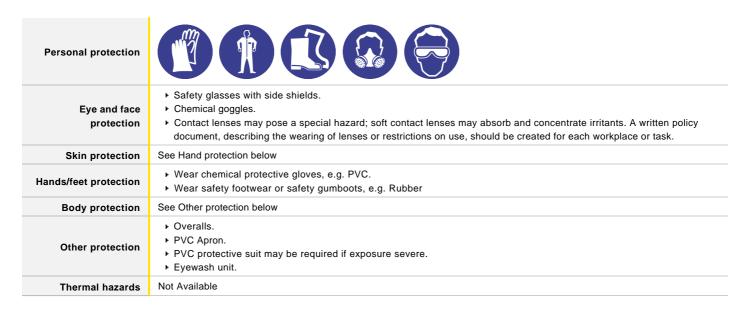

Respiratory protection

Type A Filter of sufficient capacity. (AS/NZS 1716 & 1715, EN 143:2000 & 149:2001, ANSI Z88 or national equivalent)

SECTION 9 PHYSICAL AND CHEMICAL PROPERTIES

Information on basic physical and chemical properties

Appearance	Coloured flammable liquid with a hydrocarbon odour; does not mix with water.				
Physical state	Liquid	Relative density (Water = 1)	Not Available		
Odour	Not Available	Partition coefficient n-octanol / water	Not Available		
Odour threshold	Not Available	Auto-ignition temperature (°C)	296		
pH (as supplied)	Not Available	Decomposition temperature	Not Available		
Melting point / freezing point (°C)	Not Available	Viscosity (cSt)	Not Available		
Initial boiling point and boiling range (°C)	162-192	Molecular weight (g/mol)	Not Applicable		
Flash point (°C)	41	Taste	Not Available		
Evaporation rate	0.14 BuAC = 1	Explosive properties	Not Available		
Flammability	Flammable.	Oxidising properties	Not Available		
Upper Explosive Limit (%)	6.5	Surface Tension (dyn/cm or mN/m)	Not Available		
Lower Explosive Limit (%)	0.7	Volatile Component (%vol)	Not Available		
Vapour pressure (kPa)	0.37 @ 20C	Gas group	Not Available		
Solubility in water (g/L)	Immiscible	pH as a solution (1%)	Not Available		
Vapour density (Air = 1)	>1	VOC g/L	Not Available		

SECTION 10 STABILITY AND REACTIVITY

Reactivity	See section 7
Chemical stability	 Unstable in the presence of incompatible materials. Product is considered stable. Hazardous polymerisation will not occur.
Possibility of hazardous reactions	See section 7

Issue Date: 01/01/2013 Print Date: 12/07/2016

Galmet Hammered Metal Finish

Conditions to avoid	See section 7
Incompatible materials	See section 7
Hazardous decomposition products	See section 5

SECTION 11 TOXICOLOGICAL INFORMATION

	Information	on	toxico	logical	effects
--	-------------	----	--------	---------	---------

Inhaled	Inhalation of high concentrations of gas/vapour causes lung irritation with coughing and nausea, central nervous depression with headache and dizziness, slowing of reflexes, fatigue and inco-ordination. If exposure to highly concentrated solvent atmosphere is prolonged this may lead to narcosis, unconsciousness, even coma and possible death.
Ingestion	Considered an unlikely route of entry in commercial/industrial environments. The liquid may produce gastrointestinal discomfort and may be harmful if swallowed.
Skin Contact	This material can cause inflammation of the skin on contact in some persons. The material may accentuate any pre-existing skin condition
Еуе	The material may be irritating to the eye, with prolonged contact causing inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.
Chronic	Chronic solvent inhalation exposures may result in nervous system impairment and liver and blood changes. [PATTYS] Constant or exposure over long periods to mixed hydrocarbons may produce stupor with dizziness, weakness and visual disturbance, weight loss and anaemia, and reduced liver and kidney function. Skin exposure may result in drying and cracking and redness of the skin.

Chronic	disturbance, weight loss and anaemia, and reduced liver and kidney function. Skin exposure may result in drying and cracking and redness of the skin.		
Galmet Hammered	TOXICITY	IRRITATION	
Metal Finish	Not Available	Not Available	

	TOXICITY	IRRITATION
uskita anisit	Inhalation (rat) LC50: >1400 ppm/8hr ^[2]	Eye (human): 470 ppm/15m
white spirit		Eye (rabbit): 500 mg/24h moderate
		Nil reported
	TOXICITY	IRRITATION
	Dermal (rabbit) LD50: >1700 mg/kg ^[2]	Eye (human): 200 ppm irritant
xylene	Inhalation (rat) LC50: 5000 ppm/4hr ^[2]	Eye (rabbit): 5 mg/24h SEVERE
	Oral (rat) LD50: 4300 mg/kg ^[2]	Eye (rabbit): 87 mg mild
		Skin (rabbit):500 mg/24h moderate

1. Value obtained from Europe ECHA Registered Substances - Acute toxicity 2.* Value obtained from manufacturer's SDS.
Unless otherwise specified data extracted from RTECS - Register of Toxic Effect of chemical Substances

	This product contains benzene which is known to cause acute myeloid leukaemia and n-hexane which has been shown to
	metabolize to compounds which are neuropathic.
WILLIE ODIDIT	This product contains toluene. There are indications from animal studies that prolonged exposure to high concentrations of
WHITE SPIRIT	taliana maniland ta bandin ni lan

Legend:

toluene may lead to hearing loss.

This product contains ethyl benzene and naphthalene from which there is evidence of tumours in rodents

Carcinogenicity: Inhalation exposure to mice causes liver tumours, which are not considered relevant to humans.

white spirit, as CAS RN 8052-41-3

XYLENE

The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis. The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness,

swelling, the production of vesicles, scaling and thickening of the skin.

The substance is classified by IARC as Group 3:

NOT classifiable as to its carcinogenicity to humans.

Evidence of carcinogenicity may be inadequate or limited in animal testing.

Reproductive effector in rats

Acute Toxicity	0	Carcinogenicity	0
Skin Irritation/Corrosion	~	Reproductivity	0

Page 7 of 9

Issue Date: **01/01/2013**Print Date: **12/07/2016**

Galmet Hammered Metal Finish

Serious Eye Damage/Irritation	0	STOT - Single Exposure	✓
Respiratory or Skin sensitisation	0	STOT - Repeated Exposure	0
Mutagenicity	0	Aspiration Hazard	~

Legend:

- 🗶 Data available but does not fill the criteria for classification
- ✓ Data required to make classification available

SECTION 12 ECOLOGICAL INFORMATION

Toxicity

Ingredient	Endpoint	Test Duration (hr)	Species	Value	Source
xylene	EC50	24	Crustacea	0.711mg/L	4
xylene	LC50	96	Fish	0.0013404mg/L	4
xylene	EC50	48	Crustacea	>3.4mg/L	2
xylene	EC50	72	Algae or other aquatic plants	4.6mg/L	2
xylene	NOEC	73	Algae or other aquatic plants	0.44mg/L	2
Legend:	Extracted from 1. IUCLID Toxicity Data 2. Europe ECHA Registered Substances - Ecotoxicological Information - Aquatic Toxicity 3. EPIWIN Suite V3.12 - Aquatic Toxicity Data (Estimated) 4. US EPA, Ecotox database - Aquatic Toxicity Data 5. ECETOC Aquatic Hazard Assessment Data 6. NITE (Japan) - Bioconcentration Data 7. METI (Japan) - Bioconcentration Data 8. Vendor Data				

DO NOT discharge into sewer or waterways.

Persistence and degradability

Ingredient	Persistence: Water/Soil	Persistence: Air
xylene	HIGH (Half-life = 360 days)	LOW (Half-life = 1.83 days)

Bioaccumulative potential

Ingredient	Bioaccumulation
xylene	MEDIUM (BCF = 740)

Mobility in soil

Ingredient	Mobility
	No Data available for all ingredients

SECTION 13 DISPOSAL CONSIDERATIONS

Waste treatment methods

Product / Packaging disposal

- ► Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: burial in a land-fill specifically licenced to accept chemical and / or pharmaceutical wastes or Incineration in a licenced apparatus (after admixture with suitable combustible material).
- ▶ Decontaminate empty containers.

SECTION 14 TRANSPORT INFORMATION

Labels Required



Marine Pollutant

NO

HAZCHEM

•3Y

Chemwatch: 53767 Page 8 of 9

Version No: 2.1.1.1 Galmet Hammered Metal Finish

ge 8 of 9 Issue Date: 01/01/2013
Print Date: 12/07/2016

Land transport (ADG)

UN number	1263
UN proper shipping name	PAINT (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound)
Transport hazard class(es)	Class 3 Subrisk Not Applicable
Packing group	III
Environmental hazard	Not Applicable
Special precautions for user	Special provisions 163 223 367 Limited quantity 5 L

Air transport (ICAO-IATA / DGR)

. , -	,			
UN number	1263			
UN proper shipping name	Paint (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base); Paint related material (including paint thinning or reducing compounds)			
Transport hazard class(es)	ICAO/IATA Class	3		
	ICAO / IATA Subrisk	Not Applicable		
	ERG Code	RG Code 3L		
Packing group	III			
Environmental hazard	Not Applicable			
Special precautions for user	Special provisions		A3 A72 A192	
	Cargo Only Packing Instructions		366	
	Cargo Only Maximum Qty / Pack		220 L	
	Passenger and Cargo Packing Instructions		355	
	Passenger and Cargo Maximum Qty / Pack		60 L	
	Passenger and Cargo Limited Quantity Packing Instructions		Y344	
	Passenger and Cargo Limited Maximum Qty / Pack		10 L	

Sea transport (IMDG-Code / GGVSee)

UN number	1263			
UN proper shipping name	PAINT (including paint, lacquer, enamel, stain, shellac solutions, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound)			
Transport hazard class(es)	IMDG Class 3 IMDG Subrisk Not Applicable			
Packing group	III			
Environmental hazard	Not Applicable			
Special precautions for user	EMS Number F-E, S-E Special provisions 163 223 367 955 Limited Quantities 5 L			

Transport in bulk according to Annex II of MARPOL and the IBC code

Not Applicable

SECTION 15 REGULATORY INFORMATION

Safety, health and environmental regulations / legislation specific for the substance or mixture

WHITE SPIRIT(8052-41-3.) IS FOUND ON THE FOLLOWING REGULATORY LISTS

Chemwatch: 53767 Page 9 of 9 Issue Date: 01/01/2013

Version No: 2.1.1.1 Print Date: 12/07/2016 **Galmet Hammered Metal Finish**

Australia Exposure Standards	Australia Inventory of Chemical Substances (AICS)
Australia Hazardous Substances Information System - Consolidated Lists	International Agency for Research on Cancer (IARC) - Agents Classified
	by the IARC Monographs

XYLENE(1330-20-7) IS FOUND ON THE FOLLOWING REGULATORY LISTS

Australia Exposure Standards	Australia Inventory of Chemical Substances (AICS)
Australia Hazardous Substances Information System - Consolidated Lists	International Agency for Research on Cancer (IARC) - Agents Classified
	by the IARC Monographs

National Inventory	Status
Australia - AICS	Y
Canada - DSL	Y
Canada - NDSL	N (white spirit; xylene)
China - IECSC	Y
Europe - EINEC / ELINCS / NLP	Υ
Japan - ENCS	N (white spirit)
Korea - KECI	Y
New Zealand - NZIoC	Y
Philippines - PICCS	Y
USA - TSCA	Y
Legend:	Y = All ingredients are on the inventory N = Not determined or one or more ingredients are not on the inventory and are not exempt from listing(see specific ingredients in brackets)

SECTION 16 OTHER INFORMATION

Other information

Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net

The SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright.

Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.